tion parts.

Restored Bulle 178735

Telephone 01454-880825

Or Mobile 07969-773480 Email peter_smith@horologix.com

Contact Peter Smith



Bulle Clock Serial Number 178735

Restoration of Bulle Clock Serial Number 178735

Copyright © 2012 Peter J Smith



The place to come for all your Bulle and Eureka restoration parts.

Contact Peter Smith Telephone 01454-880825 Or Mobile 07969-773480 Email peter_smith@horologix.com

Bulle Clock Serial Number 178735





Photos by kind permission of the owner.

The clock as delivered.

A short movement Clockette on a round wooden base. No dome supplied. The clock was delivered in parts well bagged up and tagged. Some of the sub assemblies were still complete such as the pendulum. After checking I found no parts missing and so it was just a job of cleaning and reassembling.



Copyright © 2012 Peter J Smith

The place to come

for all your Bulle

and Eureka restora-

tion parts.

Restored Bulle 178735

Telephone 01454-880825

Or Mobile 07969-773480 Email peter_smith@horologix.com


Contact Peter Smith



Bulle Clock Serial Number 178735



The pendulum complete as supplied. No parts missing.

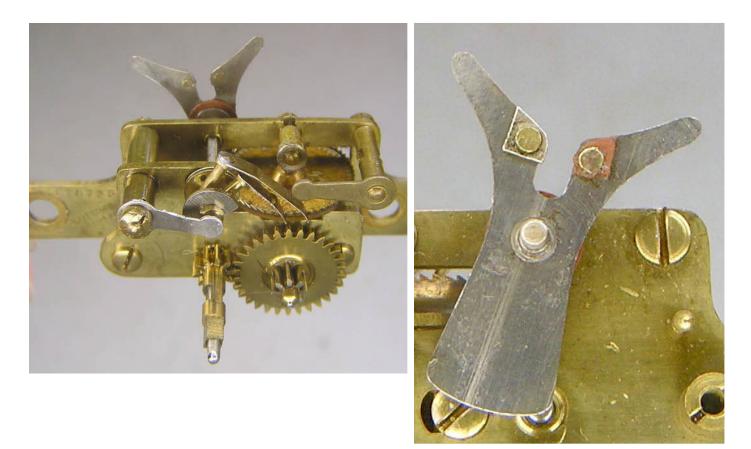

The movement itself is complete and in good condition. The fork fibre insulator is very worn and needs replacing. The silver contact though is pretty good with hardly any wear on the inside, so it will be kept. All the assemblies can now be stripped and cleaned.

The place to come

for all your Bulle

and Eureka restora-

tion parts.

Restored Bulle 178735


Telephone 01454-880825

Or Mobile 07969-773480 Email peter_smith@horologix.com

Contact Peter Smith



Bulle Clock Serial Number 178735

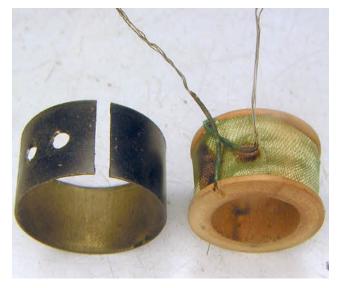


The coil proved to be fine with a 1200 Ohm resistance. The lead out wires are OK and just need tidying up with new insulation.

The base is very good and only need a coat of wax.

The only real problem with the clock was the dial support bar which had the screw holes drilled out such that the screws no longer fitted. When I checked the photos supplied by the owner I noticed that the screws had nuts applied to them after passing through the dial and bar. I replaced the bar with and original and the screws then screwed in perfectly. The arrows show the large holes in the bar supplied compared to an original bar behind. I used this bar after cleaning.

The last photo shows the pendulum back in place with a new suspension.



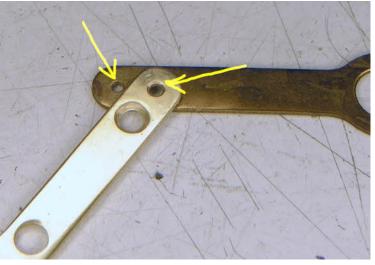




Copyright © 2012 Peter J Smith

Restored Bulle 178735



Bulle Clock Serial Number 178735

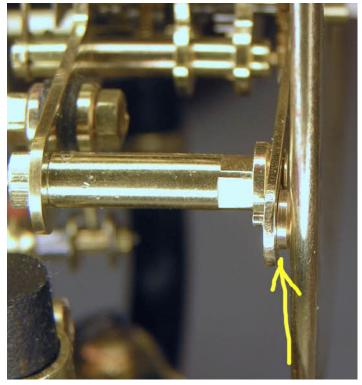

The new bar in place with original screws

The place to come for all your Bulle and Eureka restoration parts. Contact Peter Smith Telephone 01454-880825 Or Mobile 07969-773480 Email peter_smith@horologix.com



New hair spring from an alarm clock



Movement back in place

Copyright © 2012 Peter J Smith

Restored Bulle 178735



The place to come for all your Bulle and Eureka restoration parts. Contact Peter Smith Telephone 01454-880825 Or Mobile 07969-773480 Email peter_smith@horologix.com

Bulle Clock Serial Number 178735



The Finished Clock

